



HIGHWAY 33 AUTOPRO

160 Hwy 33 East
Kelowna, BC V1X 2A2

250-765-9620
highway33autopro.com



Hwy 33 Autopro Level 1 Maintenance Inspection

Customer:	John Smith	License:	123 ABC
Vehicle:	2004 Honda CR-V	VIN:	JHLRD7745*****
Inspection date:	11/20/2017	Odometer:	in: 213,554- km
Repair Order #:		Technician:	Doug Hoy

We have inspected your vehicle with the following results:



Doug Hoy, Technician



Randy Raincock, Service Advisor

Good

On the Floor	Observation	Action
Vehicle walk-around	Image(s): http://tinyurl.com/ycn39hep http://tinyurl.com/ya6q25wm <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	
Battery load test	200 amps @ 9.6 volts Image(s): http://tinyurl.com/y7qynuwd <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	
Coolant	Good to -40 deg C	
Brake fluid	Brake fluid - 1% moisture content - pass	
Washer fluid	Topped up - 1 jug	
On Hoist: Convenient height for wheel work	Observation	Action



Your Source of Vehicle Maintenance Knowledge. For More Details Click [Here](#)

Good

Winter Tire condition	Tread Depth - 9/32" <i>Image(s):</i> http://tinyurl.com/y86pe5dx http://tinyurl.com/y9sl82y2 http://tinyurl.com/y7j6capd <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	
Tire Pressure	34 PSI	
Front brake pads	Brake pads - 8 mm remaining <i>Image(s):</i> http://tinyurl.com/y9w2dskv http://tinyurl.com/y7mkz4ck <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	
Front brake rotors	<i>Image(s):</i> http://tinyurl.com/ybrqjcfp <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	
Rear brake pads	Brake pads - rear - 5MM <i>Image(s):</i> http://tinyurl.com/yab2hmoh <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	
Rear brake rotors	<i>Image(s):</i> http://tinyurl.com/ycdmyqq3 <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	

Good

On the Floor

- | | | |
|------------------------------|----------------------|----------------------|
| ✓ Insurance decal | ✓ Window operation | ✓ Pedal condition |
| ✓ Wipers | ✓ Windshield washers | ✓ Heat - A/C |
| ✓ Battery cables/connections | ✓ Horn Operation | ✓ Headlamp operation |
| ✓ Power steering fluid | ✓ Motor Mounts | |

On Hoist: Convenient height for wheel work

- | | | |
|-------------------------------|--------------------------------|-------------------------------|
| ✓ Front suspension components | ✓ Front struts/shock absorbers | ✓ Rear struts/shock absorbers |
| ✓ Steering | ✓ Front brake calipers | ✓ Front brake hardware |
| ✓ Front brake hoses | ✓ Rear brake calipers | ✓ Rear brake hoses |
| ✓ Park brake | ✓ Wheel bearings | |

On hoist: Full Height

- | | | |
|------------------------|------------------|----------------------|
| ✓ Drivetrain | ✓ Exhaust System | ✓ Coolant |
| ✓ Power steering fluid | ✓ Transmission | ✓ Front differential |
| ✓ Rear differential | | |



Your Source of Vehicle Maintenance Knowledge. For More Details Click [Here](#)

Advise

On the Floor	Observation	Action
Oil change sticker	Overdue By 2,000kms <i>Image(s):</i> http://tinyurl.com/y7768gm5 <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	
Napa Roadside Assistance sticker	Missing	At Highway 33 Autopro, we offer a 24 hour roadside assistance program.
Serpentine belt(s)	Cracking - minor <i>Image(s):</i> http://tinyurl.com/ybcc9opa <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	Future replacement required Monitor
Air filter	Air filter suggested next service	Future replacement required
Engine oil	Engine oil low Approx 1.5L low	
On hoist: Full Height	Observation	Action
Engine oil	Oil leak from front of engine Very minor at this time - looks like timing cover <i>Image(s):</i> http://tinyurl.com/y78sbxmr <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	Monitor

Marginal

On Hoist: Convenient height for wheel work	Observation	Action
Summer / M&S Tire Condition	Tread Depth - 5/32" Marginal for next season <i>Image(s):</i> http://tinyurl.com/yaegngbd http://tinyurl.com/yb8v3v5e <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	
Rear Suspension components	Stabilizer bar end links Minor play in right rear end link <i>Image(s):</i> http://tinyurl.com/ybeyc8pw <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i>	Monitor

Service Required

On the Floor	Observation	Action
--------------	-------------	--------



Your Source of Vehicle Maintenance Knowledge. For More Details Click [Here](#)

Service Required

Windshield condition	<p>Windshield required</p> <p><i>Image(s):</i> http://tinyurl.com/y8bu6c9r <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i></p>	Replacement required
Guages/warning lamps	<p>Check engine light on SRS airbag lamp on</p> <p><i>Image(s):</i> http://tinyurl.com/yd4m9fx8 <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i></p>	Diagnose
Tail lamp operation	<p>Highmount brake lamp License plate lamp 194 7443</p> <p><i>Image(s):</i> http://tinyurl.com/ycm6fvxh http://tinyurl.com/yabyxqf8 <i>Right-hand mouse-click on link and select 'Open Link in New Tab'</i></p>	<p>Bulb replacement required Replaced this service</p>



Your Source of Vehicle Maintenance Knowledge. For More Details Click [Here](#)

Additional Information



Vehicle walk-around



Vehicle walk-around



Your Source of Vehicle Maintenance Knowledge. For More Details Click [Here](#)



Oil change sticker




Windshield condition



Your Source of Vehicle Maintenance Knowledge. For More Details Click [Here](#)




Battery load test

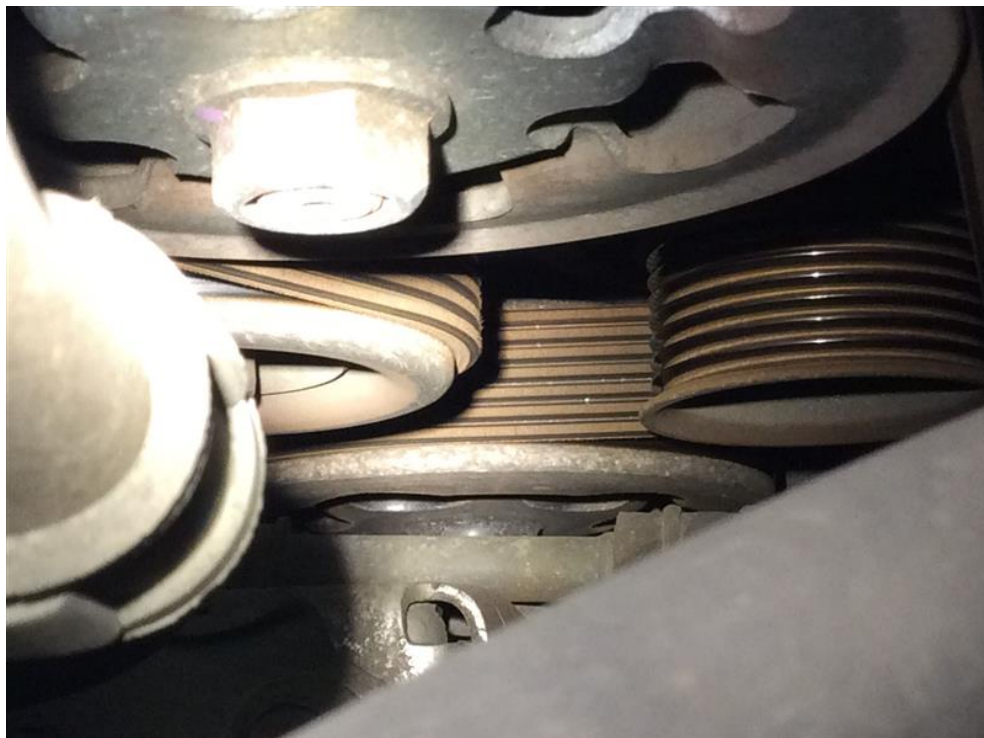

Serpentine belt(s)



Gauges/warning lamps

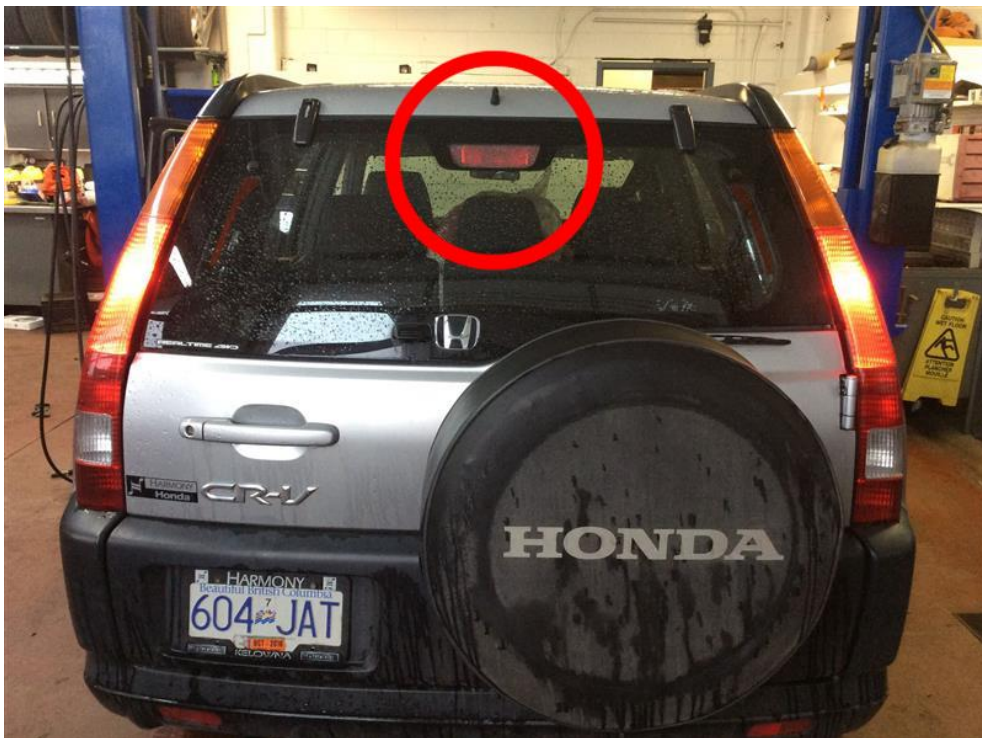

Tail lamp operation



Tail lamp operation



Winter Tire condition



Winter Tire condition



Winter Tire condition



Summer / M&S Tire Condition



Summer / M&S Tire Condition



Rear Suspension components



Front brake pads



Front brake pads



Front brake rotors



Rear brake pads



Rear brake rotors



Engine oil